

SUPRATECH

HYGIENE ON THE MOVE!




SLD03



REMOTE CONTROL FOR INFRARED
SENSOR ADJUSTMENTS

Remote control for infrared sensor adjustments

Ref. **SLD03**

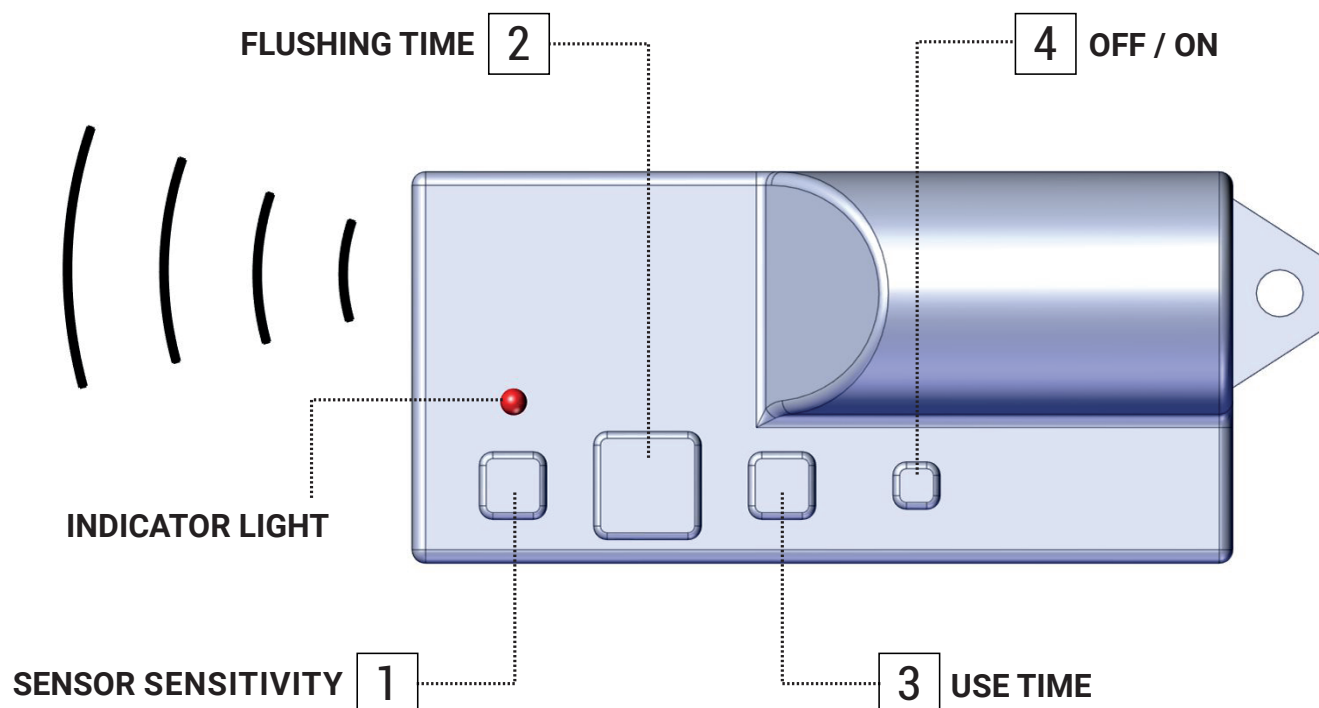


OPERATING MODE

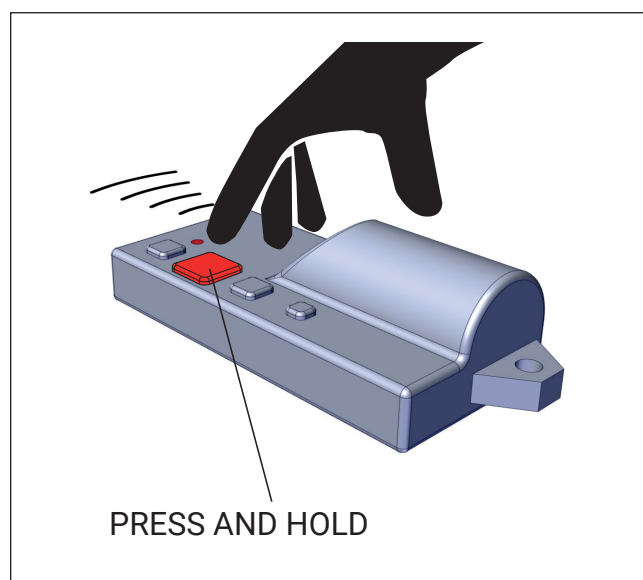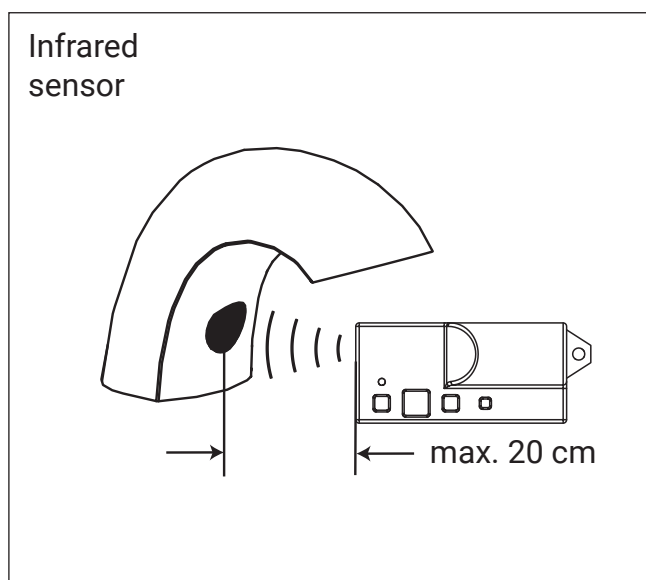


SENSOR SETTINGS

ON / OFF (open a settings period for 20 minutes)

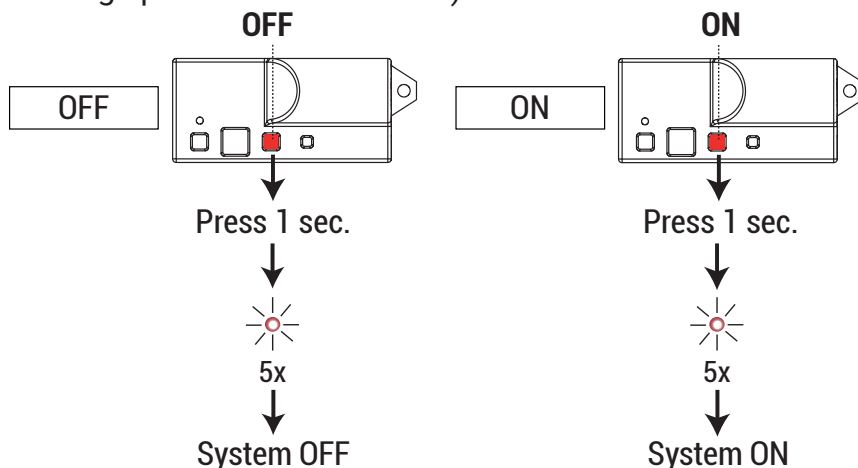


STANDARD ↔ ON/OFF

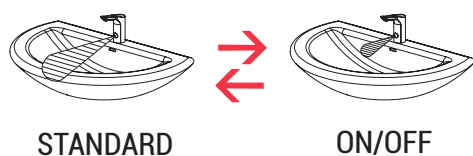


In **STANDARD** mode, the water flows when hands approach and stops when hands are removed


In **ON/OFF** mode, water starts and stops automatically after a set duration when hands approach within approximately 5 cm of the sensor (or stops if the sensor is approached before the end of the set time).

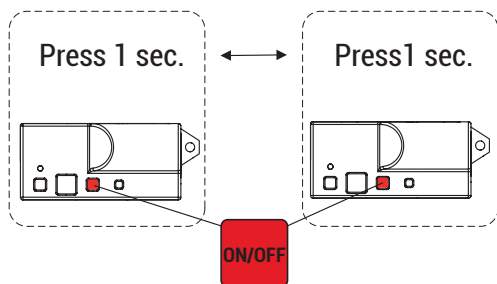


RESTORE FACTORY SETTINGS

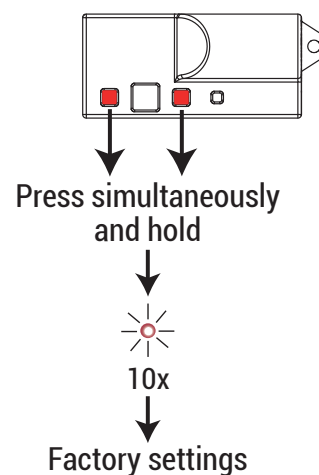

ADJUSTMENT MODE

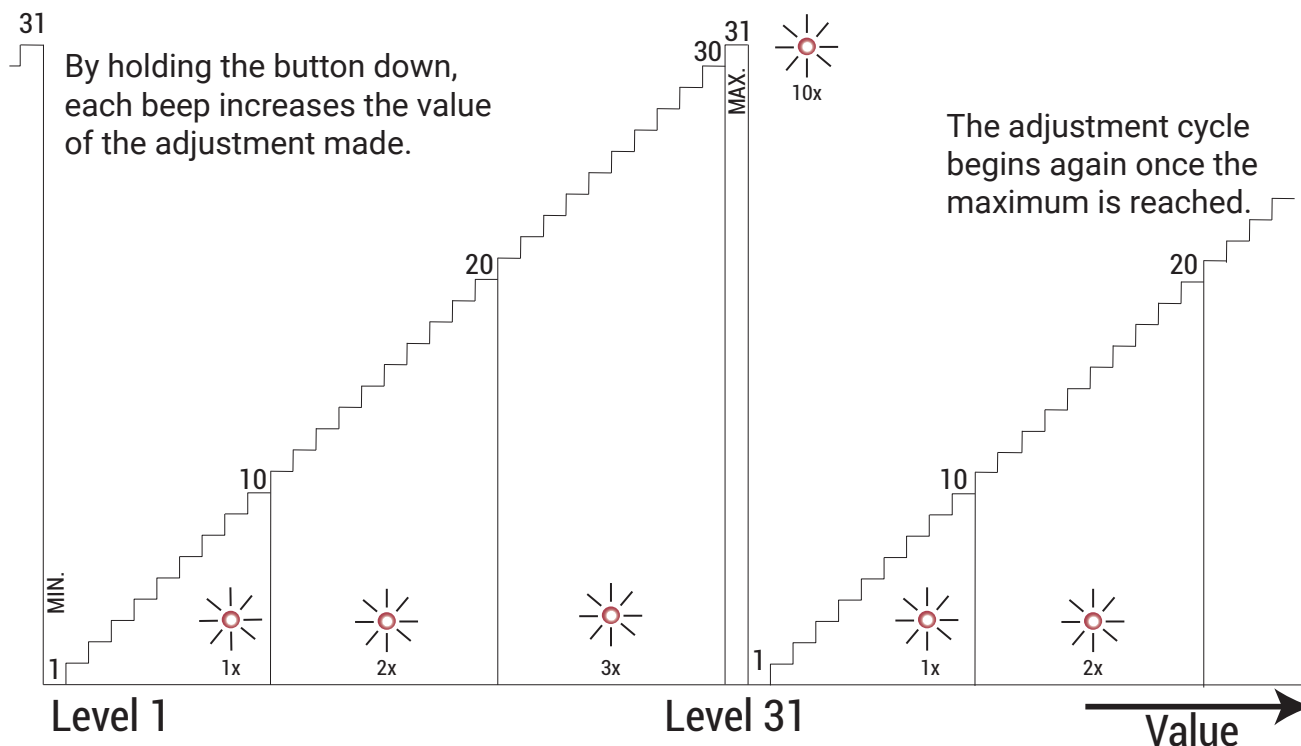




PRODUCT OVERVIEW

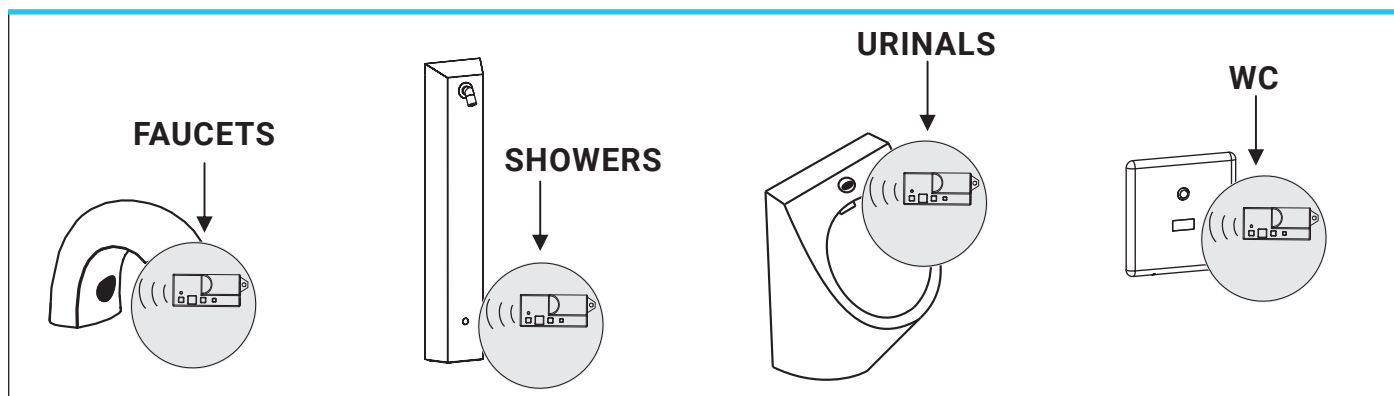

SETTING ADJUSTMENTS


1.1	BUTTON	FUNCTION		WASHBASIN	SHOWER	URINAL	WC
1.		Sensitivity (sensor range)	number of levels	31	31	31	31
			settings	0,1 - 0,3 m	0,3 - 0,7 m	0,3 - 0,7 m	0,3 - 0,7 m
			level	-			
			factory settings				
1.		Sensitivity for START / STOP	number of levels	4	4	-	
			settings	4 / 8 / 12 / 16	4 / 8 / 12 / 16		
			level	4	4		
			factory settings	3 steps	3 steps		
2.		Flow time out	number of levels	31	31	-	
			settings	0,25 - 7,75 s.	0,25 - 7,75 s.		
			level	0,25 s.	0,25 s.		
			factory settings	0,25 s.	0,3 s.		
2.		Short flushing time	number of levels	-		31	31
			settings			0,5 - 15,5 s.	0,5 - 15,5 s.
			level			0,5 s.	0,5 s.
			factory settings			0,3 s.	5 s.

SETTING ADJUSTMENTS

1.2	BUTTON	FUNCTION		WASHBASIN	SHOWER	URINAL	WC	
2.		Flow time out for START / STOP	number of levels	31		-		
			settings	10 s. - 310 s.				
			level	10 s.				
			factory settings	310 s.				
4.		Periodic rinse interval	number of levels	7		-		
			settings	OFF / 6h. / 8h. / 12h. / 24h. / 72h. / 7j.				
			level	-				
			factory settings	OFF	OFF			
1.+4.		Automatic rinse time	number of levels	31			-	
			settings	5 - 1200 s.				
			level	1 - 6 7 - 12 13 - 21 22 - 30 31	5 - 30s. 40 - 90 s. 120 - 360 s. 420 - 900 s. 1200 s.	5 s. 10 s. 30 s. 60 s.		
			factory settings	5 s.				
2.+3.		Pre-rinse / post-flush	number of levels	-			4	-
			settings					
			level				1.OFF 2. pre-rinse ON 3. post-flush ON 4. pre-rinse ON + post-flush ON	
			factory settings					




PERIODIC RINSE

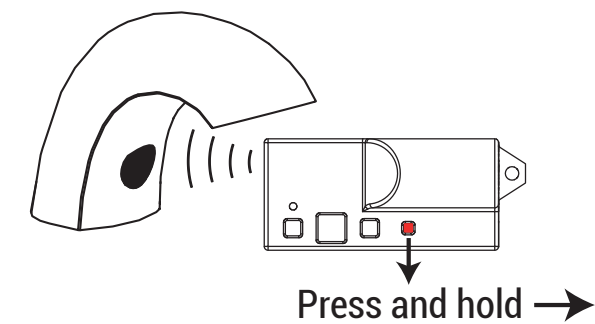

2			
LEVEL		INDICATOR 	HOURS
	1	1x	OFF
	2	1x	6
	3	1x	8
	4	1x	12
	5	2x	24
	6	2x	72
	7	10x	168

PRE-RINSE / POST-FLUSH

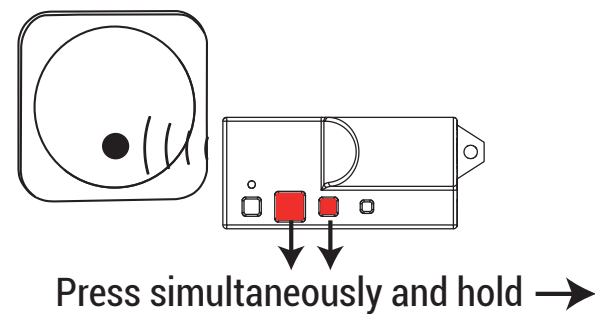

3			
LEVEL	INDICATOR 	HOURS	
		PRE-RINSE	POST-FLUSH
1	1x	OFF	OFF
2	2x	ON	OFF
3	3x	OFF	ON
4	10x	ON	ON

For urinal flush

[illegible]

SUPRATECH

AUTOMATED SYSTEMS - SANITARY ACCESSORIES - STAINLESS STEEL SANITARY WARE

2, rue des Cyprès - 37240 Bossée - France
Tel : (33)2 47 92 23 31 - Fax : (33)2 47 92 84 71
info@autosanit.com
www.autosanit.com



09.2024